

YEAR 20 Date	_	RECORDING TACH TIME	TODAY'S FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, T Entries must be endorsed with Name Technician or Repair Facility. (See ba	e, Rating and Certificate Number of
		th Delta Avia		I	Helena-West Helena, AR 72390 s/n 298608-R	870-572-9011
	Clean and ca Reass recert SA520 pins. #4=52 recerti Cleand with T Install AD200 AD20	OH: 0.0 poletely disassembled and inspected amshaft were recembled with new iffied by Aircraft 006-A20P, all with 6000024934, #5 iffied by Aircraft ed, inspected and CM SB96-7C. It is magnetos over 23-17-04 - N/A 22-16-03 - N/A 10-11-04 - N/A 10-15 - P/C/W 17-03 - N/A 14-06 - N/A 14-06 - N/A 15-05 - N/A	eled engine. all internal ertified by A main beari Specialties ith matching ere installed = 52600002. Specialties it reinstalled installed fue rhauled by A A A A A A A A A A A A A A A A A A	Converted this e parts. Reassemb Aircraft Specialtic ngs (M10), oil travit new bearing piston weights of in the following 4935, #6=526000 with new thrust v starter adapter. All system overhau Aircraft Magneto AD2023-09-09 — AD2016-16-12 — AD2009-19-01 — NAD93-08-17 — NAD88-03-06 — NAD88-03-06 — NAD80-01-04 —	MAJOR ENGINE OVERHAUL Ingine from IO-520-CB to IO-520-BB in according to the engine: Crankcase was recertified by DIVE and the engine and alternator drive ansfer collar (M10), thrust washers and through an engine was assembled and instance and the engine was assembled with all new Superior hydraulic washers and rocker shafts. Cleaned, inspected a Engine was assembled with all new gaskets and engine was assembled and timed to engine. Installed new ig N/A AD2023-05-16 – N/A AD2014-05-29 – N/A AD2017-04-19R1 – N/A AD98-17-11C – N/A AD98-17-11C – N/A AD98-13-04R3 – N/A AD79-05-09 – N/A	CO, crankshaft with counterweights, gears with new hardware. In bolts. Installed connecting rods uperior Millennium cylinders p/n alled on new pistons with new piston 1932, #3=526000024933, lifters. Installed all rocker arms and reinstalled oil pump assembly. In the counterweights, and seals and torqued in accordance

YEAR 20 Date	RECORDIN TACH TIME	G TODAY'S FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests Entries must be endorsed with Name, Rati Technician or Repair Facility. (See back pa	ing and Certificate Number of			
	South Delta	Aviation		Helena-West Helena, AR 72390	870-572-9011			
	Tach: 5262.9 Completed annual inspection this date: Installed this engine s/n 298608-R on N4316W, F33A, s/n CE-485 using new engine mounts and hardware. Reinstalled engine baffles. Reinstalled exhaust system with new right hand stack assembly. Reinstalled alternator, starter, prop governor, dry air pump, and stand by alternator. Serviced with Phillips 20W50 Type M mineral oil and pre-oiled engine. Connected lines and hoses. Purged fuel system and leak checked. Performed ground run up and adjusted low fuel pressure, idle mixture and idle speed, checked fuel flow as outlined in TCM SID97-3E. Ground run was performed as stated in TCM SB M89-7 R1, para. III. Aircraft was test flown for 45 minutes – all parameters were normal with no leaks detected. See AD list in aircraft records							
	v							